

## The Shop- RC Classics LLC

74852 Lennon Place Ste 5

Palm Desert, CA 92260

(760) 568-3450

### Exterior

#### Paint: Professionally Refinished

- Nice Candy Color 3 stage paint process, including door jambs;
- Overall good condition – nice shine, coverage;
- Under hood and under trunk jambs poorly spray can painted black;
- 1" ding in hood/chipped paint and  $\frac{3}{8}$ " chip in corresponding header panel;
- 2" ding left hood edge and chip;
- Multiple chips left rocker panel edge;
- 2" scratch to primer left lower quarter panel;
- Minor 4" clear coat abrasions right rear quarter panel near tail lamp;
- $\frac{1}{4}$ " chip center right door;
- $\frac{1}{4}$ " chip right rocker edge;
- Obvious paint edges right and left door jambs at quarter panel;
- Sanding scratches/swelling on hood, deck lid, left fender towards rear at door;
- Minor 4" clear coat abrasion on left fender towards the rear at door.

#### Chrome Condition:

- Front Bumper/Grille – Excellent;
- Headlight Bezels – Good;
- Side body chrome moldings – Good;
- Lower rocker and quarter chrome – Good
- Door handles and upper chrome – Good;
- Rear Bumper – Good to Excellent;
- Emblems – Excellent;
- Windshield Chrome and Windshield Seal are original – Fair;
- Driver mirror is original – Fair.

## Body:

- Damage 2½" dent on top of right quarter panel; obvious repair – collision damage left quarter panel lower – replacement panel and improper/incomplete trunk pan repair. Obvious filler work on rear lower valance, sand scratches and unfinished;
- Small rust through spots on left and right floorboards forward at front of passenger compartment: 3" X 3" on drivers side and 6" X 3" on passenger side;
- Undercarriage is consistent, all original components. No signs of front or rear-end collision;
- Under carriage coated with fair amount of grease and oil, indicative of normal use, wear and tear. 1 jack location cover is broken & poorly glued on in place.

## Suspension:

- Consistent, appears to be all original parts, except for four Bilstein shock absorber upgrades. Clear signs of periodical chassis lubrication.

## Brake:

- Four wheel drums, recent maintenance of rear brakes, front brake stick does not release promptly or correctly. Master cylinder is in good shape with no leaks, also no leaks at wheel cylinders.

## Wheel & Tires:

- 3 new Nokian 185/70R14, directional NRH2
- 4 Zenith Wire Wheel Co. spoke wheels with 3-point knock-offs in excellent condition.
- Right front tire is worn to steel belt and not a Nokian or roadworthy.

## Engine Transmission & Driveline Components:


- Rear muffler has a 3" X 4" rusted out hole in lower exterior. Remaining exhaust in good condition;
- Rear differential leaks, but is original in good condition;
- Transmission, leak at drain plug but is original and is in good working order.
- Engine appears original except for Mikuni replacement carburetors. The engine appears and sounds solid. The carburetors work well and are probably trouble-free compared to the original. Also included are an electrical fuel pump and regulator mounted forward of the fuel tank, under the floor at the rear of the driver's compartment.

- Fuel tank is lightly mashed upwards in two locations but not detrimental to function;
- Engine oil leak at drain plug but engine oil level is correct.

### Interior & Top:

- Top appears to be fairly new, it is in excellent shape, functions well and rear plastic window is clear; only a slight mar;
- Carpet is black – good condition;
- Bucket seats are white - good condition – no rips or tears;
- Dash pad is black – good condition;
- Dash is painted – good condition, all components appear original and in good working condition with the exception of the clock;
- Plastic steering wheel is original – excellent condition;
- Door Panels are white and complete – good condition;
- Sun Visors are missing;

Overall – good condition, clean, no damage

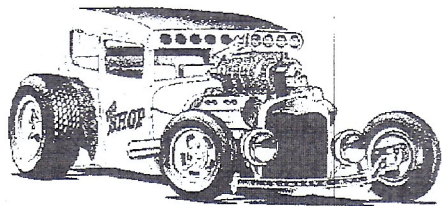

# The Shop- RC Classics

74852 Lennon Place Ste 5  
Palm Desert, CA 92260

(760) 568-3450

# Invoice

Date	Invoice #
7/27/2011	580693

Bill To
Sammye Myers 4009 Miramar Ave. Dallias, TX. 75205

Plate #	Make	Model	Mileage	Tire Pressure
968 JUP CO.	MBZ	190SL	14348	

Quantity	Description	Unit Price	Amount
2	Labor:Inspect car, Make a inspection report	80.00	160.00
1	Left front brake Hose	89.00	89.00T
1	Right front brake hose	89.00	89.00T
2	Rear brake hose	80.00	160.00T
3	Brake Fluid	4.95	14.85T
1	Light bulb	1.90	1.90T
4	Spark Plugs	3.88	15.52T
1	customer invoice service:Repair Left front tire	20.00	20.00T
5.5	Labor:Replace 3 Rubber brake hoses, bleed brakes, reinstall left rear tail light, Replace screws in right tail light, change spark plugs	80.00	440.00
1	Shipping and Handling Charge	20.00	20.00
1	Hazard Waste Fee	5.00	5.00
	Sales Tax	7.75%	30.25

*(Signature)*

We are not responsible for fire, theft, paint or damage beyond our control

Customer Signature: \_\_\_\_\_

**Total**

**\$1,045.52**